



713-730-3151

www.a-actionhouston.com

Info@aactionhouston.com



INSPECTED FOR
Sample Report
1234 Sample Road
Anywhere, TX 12345

January 7, 2022



PROPERTY INSPECTION REPORT FORM

Sample Report

01/07/2022

Name of Client

Date of Inspection

1234 Sample Road, Anywhere, TX 12345

Address of Inspected Property

Joshua Gibson

23054

Name of Inspector

TREC License #

Name of Sponsor (if applicable)

TREC License #

PURPOSE OF INSPECTION

A real estate inspection is a visual survey of a structure and a basic performance evaluation of the systems and components of a building. It provides information regarding the general condition of a residence at the time the inspection was conducted. *It is important* that you carefully read ALL of this information. Ask the inspector to clarify any items or comments that are unclear.

RESPONSIBILITY OF THE INSPECTOR

This inspection is governed by the Texas Real Estate Commission (TREC) Standards of Practice (SOPs), which dictates the minimum requirements for a real estate inspection.

The inspector IS required to:

- use this Property Inspection Report form for the inspection;
- inspect only those components and conditions that are present, visible, and accessible at the time of the inspection;
- indicate whether each item was inspected, not inspected, or not present;
- indicate an item as Deficient (D) if a condition exists that adversely and materially affects the performance of a system or component **OR** constitutes a hazard to life, limb or property as specified by the SOPs; and
- explain the inspector's findings in the corresponding section in the body of the report form.

The inspector IS NOT required to:

- identify all potential hazards;
- turn on decommissioned equipment, systems, utilities, or apply an open flame or light a pilot to operate any appliance;
- climb over obstacles, move furnishings or stored items;
- prioritize or emphasize the importance of one deficiency over another;
- provide follow-up services to verify that proper repairs have been made; or
- inspect system or component listed under the optional section of the SOPs (22 TAC 535.233).

RESPONSIBILITY OF THE CLIENT

While items identified as Deficient (D) in an inspection report DO NOT obligate any party to make repairs or take other actions, in the event that any further evaluations are needed, it is the responsibility of the client to obtain further evaluations and/or cost estimates from qualified service professionals regarding any items reported as Deficient (D). It is recommended that any further evaluations and/or cost estimates take place prior to the expiration of any contractual time limitations, such as option periods.

Please Note: Evaluations performed by service professionals in response to items reported as Deficient (D) on the report may lead to the discovery of additional deficiencies that were not present, visible, or accessible at the time of the inspection. Any repairs made after the date of the inspection may render information contained in this report obsolete or invalid.

REPORT LIMITATIONS

This report is provided for the benefit of the named client and is based on observations made by the named inspector on the date the inspection was performed (indicated above).

ONLY those items specifically noted as being inspected on the report were inspected.

This inspection IS NOT:

- a technically exhaustive inspection of the structure, its systems, or its components and may not reveal all deficiencies;
- an inspection to verify compliance with any building codes;
- an inspection to verify compliance with manufacturer's installation instructions for any system or component and DOES NOT imply insurability or warrantability of the structure or its components.

NOTICE CONCERNING HAZARDOUS CONDITIONS, DEFICIENCIES, AND CONTRACTUAL AGREEMENTS

Conditions may be present in your home that did not violate building codes or common practices in effect when the home was constructed but are considered hazardous by today's standards. Such conditions that were part of the home prior to the adoption of any current codes prohibiting them may not be required to be updated to meet current code requirements. However, if it can be reasonably determined that they are present at the time of the inspection, the potential for injury or property loss from these conditions is significant enough to require inspectors to report them as Deficient (D). Examples of such hazardous conditions include:

- malfunctioning, improperly installed or missing ground fault circuit protection (GFCI) devices and arc-fault devices;
- ordinary glass in locations where modern construction techniques call for safety glass;
- malfunctioning or lack of fire safety features such as, smoke alarms, fire-rated doors in certain locations, and functional emergency escape and rescue openings in bedrooms;
- malfunctioning carbon monoxide alarms;
- excessive spacing between balusters on stairways and porches;
- improperly installed appliances;
- improperly installed or defective safety devices;
- lack of electrical bonding and grounding; and
- lack of bonding on gas piping, including corrugated stainless steel tubing (CSST).

Please Note: items identified as Deficient (D) in an inspection report DO NOT obligate any party to make repairs or take other actions. The decision to correct a hazard or any deficiency identified in an inspection report is left up to the parties to the contract for the sale or purchase of the home.

This property inspection report may include an inspection agreement (contract), addenda, and other information related to property conditions.

INFORMATION INCLUDED UNDER "ADDITIONAL INFORMATION PROVIDED BY INSPECTOR", OR PROVIDED AS AN ATTACHMENT WITH THE STANDARD FORM, IS NOT REQUIRED BY THE COMMISSION AND MAY CONTAIN CONTRACTUAL TERMS BETWEEN THE INSPECTOR AND YOU, AS THE CLIENT. THE COMMISSION DOES NOT REGULATE CONTRACTUAL TERMS BETWEEN PARTIES. IF YOU DO NOT UNDERSTAND THE EFFECT OF ANY CONTRACTUAL TERM CONTAINED IN THIS SECTION OR ANY ATTACHMENTS, CONSULT AN ATTORNEY.

ADDITIONAL INFORMATION PROVIDED BY INSPECTOR

Inspection Time In: **2 pm** Time Out: **5 pm** Property was: **Occupied**
Building Orientation (For Purpose Of This Report Front Faces): **West**
Weather Conditions During Inspection: **Cloudy Overcast**
Outside temperature during inspection: **60 ° or Below Degrees**
Parties present at inspection: **Seller**

THIS REPORT IS PAID AND PREPARED FOR THE EXCLUSIVE USE BY Sample Report. THIS COPYRIGHTED REPORT IS NOT VALID WITHOUT THE SIGNED INSPECTION AGREEMENT.

THIS REPORT IS NOT TRANSFERABLE FROM CLIENT NAMED ABOVE.

SCOPE OF INSPECTION

These standards of practice define the minimum levels of inspection required for substantially completed residential improvements to real property up to four dwelling units. A real estate inspection is a non-technically exhaustive, limited visual survey and basic performance evaluation of the systems and components of a building using normal controls and does not require the use of specialized equipment or procedures. The purpose of the inspection is to provide the client with information regarding the general condition of the residence at the time of inspection. The inspector may provide a higher level of inspection performance than required by these standards of practice and may inspect components and systems in addition to those described by the standards of practice.

GENERAL LIMITATIONS

The inspector is not required to:

(A) inspect:

- (i) items other than those listed within these standards of practice;
- (ii) elevators;
- (iii) detached buildings, decks, docks, fences, or waterfront structures or equipment;
- (iv) anything buried, hidden, latent, or concealed;
- (v) sub-surface drainage systems;
- (vi) automated or programmable control systems, automatic shut-off, photoelectric sensors, timers, clocks, metering devices, signal lights, lightning arrestor system, remote controls, security or data distribution systems, solar panels, outdoor kitchens, gas grills (built-in or free standing), refrigerators (built-in or free standing), wine coolers, ice makers or smart home automation components; or
- (vii) concrete flatwork such as; driveways, sidewalks, walkways, paving stones or patios;

(B) report:

- (i) past repairs that appear to be effective and workmanlike except as specifically required by these standards;
- (ii) cosmetic or aesthetic conditions; or
- (iii) wear and tear from ordinary use;

(C) determine:

- (i) insurability, warrantability, suitability, adequacy, compatibility, capacity, reliability, marketability, operating costs, recalls, counterfeit products, product lawsuits, life expectancy, age, energy efficiency, vapor barriers, thermostatic performance, compliance with any code, listing, testing or protocol authority, utility sources, or manufacturer or regulatory requirements except as specifically required by these standards;
- (ii) the presence or absence of pests, termites, or other wood-destroying insects or organisms;
- (iii) the presence, absence, or risk of asbestos, lead-based paint, **MOLD**, mildew, corrosive or contaminated drywall "Chinese Drywall" or any other environmental hazard, environmental pathogen, carcinogen, toxin, mycotoxin, pollutant, fungal presence or activity, or poison;
- (iv) types of wood or preservative treatment and fastener compatibility; or
- (v) the cause or source of a conditions;

(D) anticipate future events or conditions, including but not limited to:

- (i) decay, deterioration, or damage that may occur after the inspection;
- (ii) deficiencies from abuse, misuse or lack of use;
- (iii) changes in performance of any component or system due to changes in use or occupancy;
- (iv) the consequences of the inspection or its effects on current or future buyers and sellers;
- (v) common household accidents, personal injury, or death;
- (vi) the presence of water penetrations; or
- (vii) future performance of any item;

- (E) operate shut-off, safety, stop, pressure or pressure-regulating valves or items requiring the use of codes, keys, combinations, or similar devices;
- (F) designate conditions as safe;
- (G) recommend or provide engineering, architectural, appraisal, mitigation, physical surveying, realty, or other specialist services;
- (H) review historical records, installation instructions, repair plans, cost estimates, disclosure documents, or other reports;
- (I) verify sizing, efficiency, or adequacy of the ground surface drainage system;
- (J) verify sizing, efficiency, or adequacy of the gutter and downspout system;
- (K) operate recirculation or sump pumps;
- (L) remedy conditions preventing inspection of any item;
- (M) apply open flame or light a pilot to operate any appliance;
- (N) turn on decommissioned equipment, systems or utility services; or
- (O) provide repair cost estimates, recommendations, or re-inspection services.

THE CLIENT, BY ACCEPTING THIS PROPERTY INSPECTION REPORT OR RELYING UPON IT IN ANY WAY, EXPRESSLY AGREES TO THE SCOPE OF INSPECTION, GENERAL LIMITATIONS AND INSPECTION AGREEMENT INCLUDED IN THIS INSPECTION REPORT.

This inspection report is made for the sole purpose of assisting the purchaser to determine his and/or her own opinion of feasibility of purchasing the inspected property and does not warrant or guarantee all defects to be found. If you have any questions or are unclear regarding our findings, please call our office prior to the expiration of any time limitations such as option periods.

This report contains technical information. If you were not present during this inspection, please call the office to arrange for a consultation with your inspector. If you choose not to consult with the inspector, this inspection company cannot be held liable for your understanding or misunderstanding of the reports content.

The contents of this report are for the sole use of the client named above and no other person or party may rely on this report for any reason or purpose whatsoever without the prior written consent of the inspector who authored the report. Any person or party who chooses to rely on this report for any reason or purpose whatsoever without the express written consent of the inspector does so at their own risk and by doing so without the prior written consent of the inspector waives any claim of error or deficiency in this report.

This report is not intended to be used for determining insurability or warrantability of the structure and may not conform to the Texas Department of Insurance guidelines for property insurability. *This report is not to be used by or for any property and/or home warranty company.*

The digital pictures within this report are a representative sample of inaccessible areas, deficiencies or damages in place and should not be considered to show all of the inaccessible areas, deficiencies or damages observed. There will be inaccessible areas, deficiencies or damages not represented with digital imaging.

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I NI NP D

I. STRUCTURAL SYSTEMS

☒ ☐ ☐ ☐

A. Foundations

Type of Foundation(s): Slab on Ground


Comments:

Foundation Is Performing Adequately

In my opinion, the foundation appears to be providing adequate support for the structure at the time of this inspection. I did not observe any apparent evidence that would indicate the presence of adverse performance or significant deficiencies in the foundation. The interior and exterior stress indicators showed little effects of adverse performance and I perceived the foundation to contain no significant unlevelness after walking the 1st level floors.

Additional Observations and/or Comments:

- One or more of the foundation perimeter beam corners were observed to be sheared off (corner pop). This is a common condition to observe and is due to thermal expansion and contraction of the different building materials. This condition does not adversely affect the foundation performance. However, in some cases, some cosmetic improvements may be necessary.

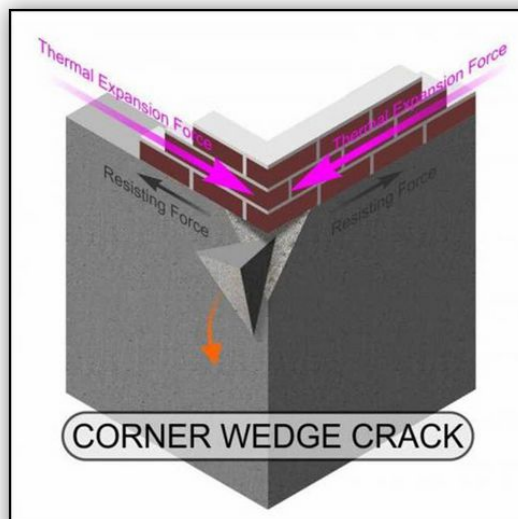

Notice: This inspection is one of first impression and the inspector was not provided with any historical information pertaining to the structural integrity of the inspected real property. This is a limited cursory and visual survey of the accessible general conditions and circumstances present at the time of this inspection. Opinions are based on general observations made without the use of specialized tools or procedures. Therefore, the opinions expressed are one of apparent conditions and not of absolute fact and are only good for the date and time of this inspection.

The inspection of the foundation may show it to be providing adequate support for the structure or having movement typical to this region, at the time of the inspection. This does not guarantee the future life or failure of the foundation. ***The Inspector is not a structural engineer. This inspection is not an engineering report or evaluation and should not be considered one, either expressed or implied.*** If any cause of concern is noted on this report, or if you want further evaluation, you should consider an evaluation by an engineer of your choice.

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---

<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>
-------------------------------------	--------------------------	--------------------------	-------------------------------------

B. Grading and Drainage

Comments:

Grading & Drainage

- There is an underground and/or surface drainage system in place. It appears that the surface water collector(s) and/or drain(s) are clogged and/or filled with debris. This condition will adversely affect the performance of the drainage system and corrective measures are needed at this time.



Gutter & Downspout System

All components were found to be performing and in satisfactory condition on the day of the inspection.

Note: The gutter downspouts should discharge water at least thirty-six inches (36") away from the foundation perimeter beam. Storm water should be encouraged to flow away from the structure at the points of discharge.



I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---

<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>
-------------------------------------	--------------------------	--------------------------	-------------------------------------

C. Roof Covering Materials

Type(s) of Roof Covering: Composition

Viewed From: Walked on roof

Comments:

Roof Covering

You are strongly encouraged to have a properly certified roofing contractor to physically inspect the roof, prior to the expiration of any time limitations such as option or warranty periods, to fully evaluate the condition of the roofing material. The observation made to support the rendering of this opinion are listed but not limited to the following:

- One or more of the shingles were observed to be lifting on the west side of the roof structure.
- Damaged shingles were observed on the east side, west side of the roof structure.
- The composition roofing material has experienced granular loss in various locations throughout the roof.

Note: Due to the limited nature of a general home inspection, it is possible that additional deficiencies will be discovered by a licensed technician. It is recommended to have the system serviced prior to the expiration of any option/warranty period.



I=Inspected NI=Not Inspected NP=Not Present D=Deficient

I	NI	NP	D
---	----	----	---



I=Inspected NI=Not Inspected NP=Not Present D=Deficient

I	NI	NP	D
---	----	----	---



I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---



Flashing Details


The flashing details needs to be checked, reset or repaired as necessary. The observations made to support the rendering of this opinion are listed but may not be limited to:

- The lead jack flashing at the plumbing vent stack needs to be checked, reset or repaired as necessary. The lead jack flashing detail was observed to be improperly installed at one or more of the roof level plumbing vent pipes. The lead flashing should run the full length of the vent pipe and turn down into the top of the vent pipe to help prevent water intrusion at this point.
- The storm collar(s) at the roof level gas equipment vent pipe(s) need to be properly sealed to help prevent water intrusion into the structure.

Note: Due to the limited nature of a general home inspection, it is possible that additional deficiencies will be discovered by a licensed technician. It is recommended to have the system serviced prior to the expiration of any option/warranty period.



I=Inspected	NI=Not Inspected	NP=Not Present	D=Deficient
I	NI	NP	D

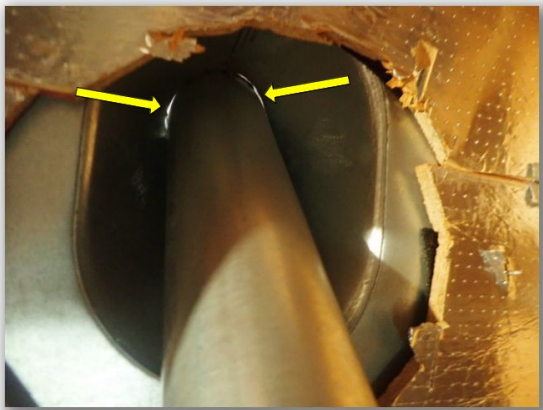

Notice: Life expectancy of the roofing material is not covered by this property inspection report. If any concerns exist about the roof covering life expectancy or potential for future problems, a roofing specialist should be consulted. The Inspector cannot offer an opinion or warranty as to whether the roof has leaked in the past, leaks now, or may be subject to future leaks, either expressed or implied.

The inspection of this roof may show it to be functioning as intended or in need of minor repairs. This inspection does not determine the insurability of the roof. You are strongly encouraged to have your Insurance Company physically inspect the roof, prior to the expiration of any time limitations such as option or warranty periods, to fully evaluate the insurability of the roof.

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---

☒ ☐ ☐ ☒

D. Roof Structures and Attics

Viewed From: Attic Decked Space Only

Approximate Average Depth of Insulation: 13+”

(**Note:** Generally recommended depth of attic floor insulation is approximately 10+ inches to achieve a R30 rating.)

Insulation Type: Loose Filled, Batt or Blanket

Description of Roof Structure: Rafter Assembly

Attic Accessibility: Partial

Comments:

Roof Structure

- It is recommended to seal all openings between the soffit and roof covering to prevent pest/rodent intrusion at this point.



Attic Ventilation

All components were found to be performing and in satisfactory condition on the day of the inspection.

Attic Insulation

All components were found to be performing and in satisfactory condition on the day of the inspection.

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---



☒ ☐ ☐ ☒

E. Walls (Interior and Exterior)

Comments:

Description of Exterior Cladding: Wood Type Veneer, Brick Veneer and Fiber Cement Board

Interior Walls & Surfaces

- Interior wall joint cracks were observed in the kitchen, garage, primary bedroom, dining room, front corner bedroom, guest bedroom, front entrance area, laundry room.

Notice: The inspector was unable to inspect all of the interior surfaces because of window treatments, personalized wall treatments / finishes, personal effects, large, heavy or fragile storage and/or furniture.




I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---

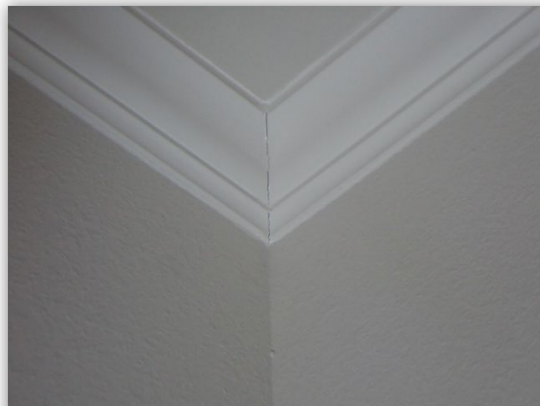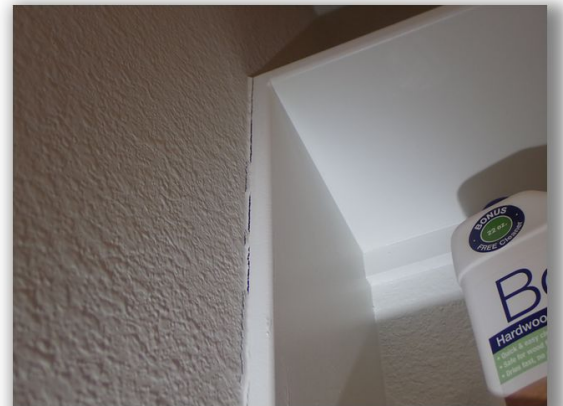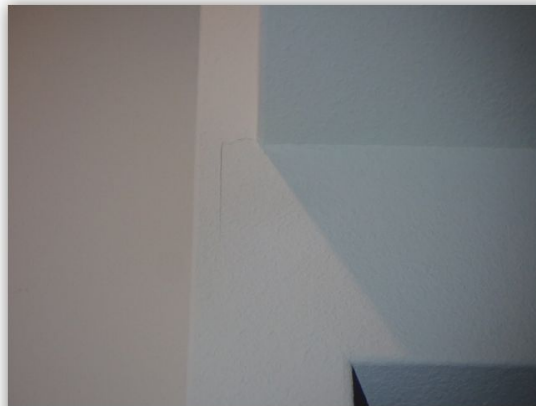

Exterior Walls & Surfaces

- Caulking improvements are recommended for the area between the exterior veneer and the window frames. It is recommended to use an elastomeric caulking.
- The area between the exterior cladding / veneer and all of the wall penetrations / openings need to be properly sealed. Areas such as utility connections, downspouts, hose bibbs, lighting fixtures, receptacles etc. It is recommended to use an elastomeric caulking / sealant.
- Caulking improvements are recommended for the area between the exterior veneer and the garage door trim boards. It is recommended to use an elastomeric caulking.
- Caulking improvements are recommended for the area between the exterior veneer and the exterior door frames. It is recommended to use an elastomeric caulking.

Note: The heavy foliage growing on, over or around the exterior walls of the structure should be trimmed back at least 18-inches. The heavy foliage will limit the inspectors visual observation of the exterior surfaces.


I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---

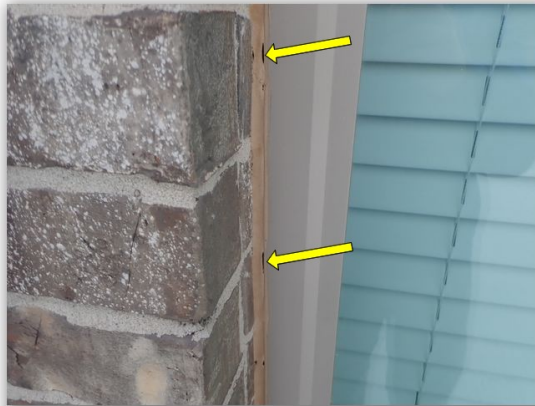

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---




☒ ☐ ☐ ☒

F. Ceilings and Floors

Comments:

Ceilings

- Ceiling joint cracks were observed in the kitchen, garage, rear middle bedroom.
- Paint touch ups are recommended in several locations.

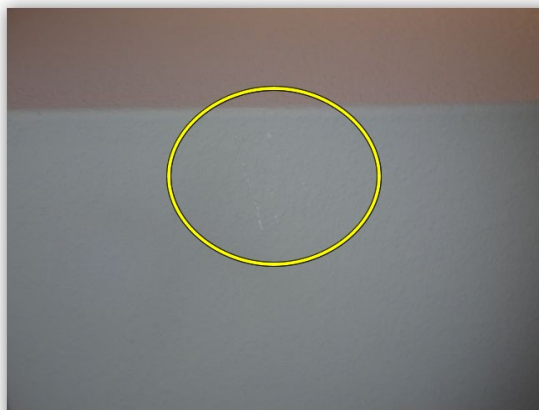

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---

Floors

All components were found to be performing and in satisfactory condition on the day of the inspection.


☒ ☐ ☐ ☒

G. Doors (Interior and Exterior)

Comments:


Interior Doors

- The door is not latching properly to the front corner bedroom closet.

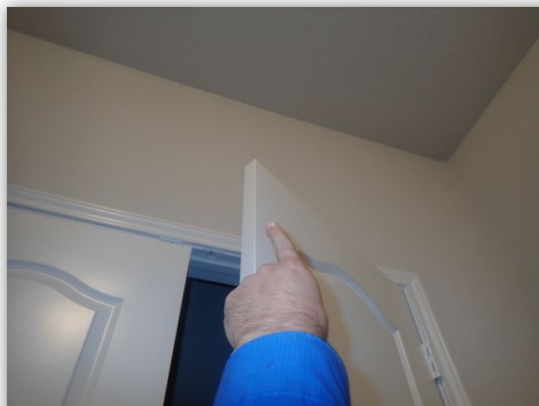

Exterior Doors

- The door hardware is not functioning properly to the backyard entry door.
- Weather-stripping improvements are recommended for the front entry exterior door(s).

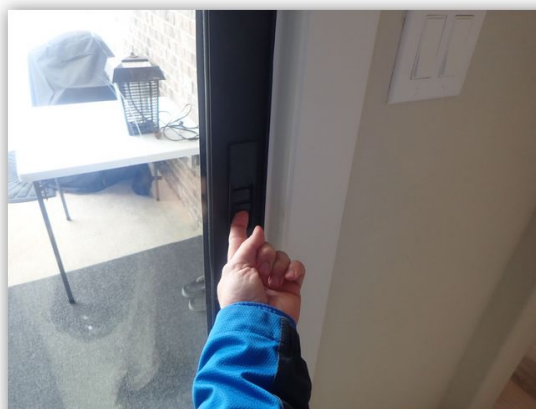

Overhead Garage Door

All components were found to be performing and in satisfactory condition on the day of the inspection.

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---

<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
-------------------------------------	--------------------------	--------------------------	--------------------------

H. Windows

Comments:

Window Screens

All components were found to be performing and in satisfactory condition on the day of the inspection.

Windows

All components were found to be performing and in satisfactory condition on the day of the inspection.

<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
--------------------------	-------------------------------------	-------------------------------------	--------------------------

I. Stairways (Interior and Exterior)

Comments:

<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
--------------------------	-------------------------------------	-------------------------------------	--------------------------

J. Fireplaces and Chimneys

Comments:

<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>
-------------------------------------	--------------------------	--------------------------	-------------------------------------

K. Porches, Balconies, Decks, and Carports

Comments:

Porches / Patio

- Minor cracks and/or deficiencies were observed in the patio.



Driveway

- Minor cracks and/or deficiencies were observed in the driveway.

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---

II. ELECTRICAL SYSTEMS

☒ ☐ ☐ ☐

A. Service Entrance and Panels

Comments:

Panel Box



Box Rating and/or Main Disconnect Rating: 125 amps

Box Location: Garage

Cabinet Manufacturer: Square D

Branch Circuit Wire Type: Copper

All components were found to be performing and in satisfactory condition on the day of the inspection.

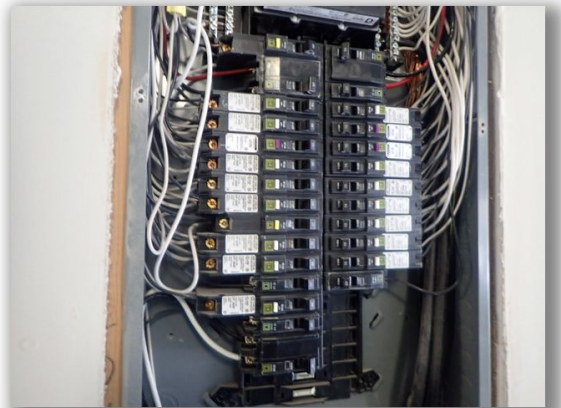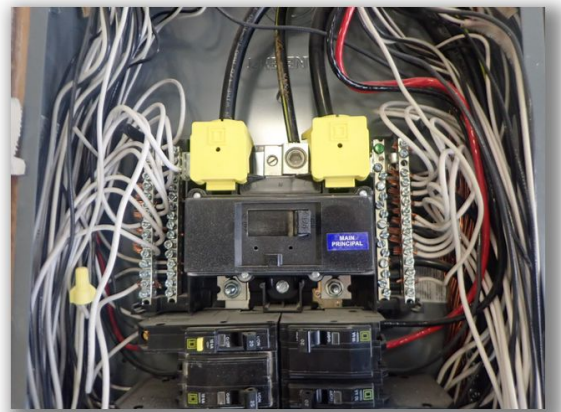

Arc-Fault Circuit Interrupter Protection (AFCI)

All components were found to be performing and in satisfactory condition on the day of the inspection.

Grounding / Bonding

All components were found to be performing and in satisfactory condition on the day of the inspection.

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---



☒ ☐ ☐ ☒

B. Branch Circuits, Connected Devices, and Fixtures

Type of Wiring: Copper

Comments:

Receptacle Outlets

All components were found to be performing and in satisfactory condition on the day of the inspection.

Note: Some of the receptacles in the home were inaccessible and could not be reached for inspection due to height, personal effects, heavy storage, furniture or conditions outside the control of the inspector.

Arc-Fault Circuit Interrupter Protection (AFCI)

All components were found to be performing and in satisfactory condition on the day of the inspection.

Switches

All components were found to be performing and in satisfactory condition on the day of the inspection.

Fixtures

- The ceiling fan was observed to be noisy when operated in the primary bedroom.



I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
----------	-----------	-----------	----------

Smoke Alarms

All components were found to be performing and in satisfactory condition on the day of the inspection.

Note: It is recommended to replace the batteries in all of the smoke detectors once a year for reasons of safety.

Carbon Monoxide Alarms

All components were found to be performing and in satisfactory condition on the day of the inspection.

Doorbell / Chime

All components were found to be performing and in satisfactory condition on the day of the inspection.

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---

III. HEATING, VENTILATION AND AIR CONDITIONING SYSTEMS

☒ ☐ ☐ ☐

A. Heating Equipment

Type of Systems:

Energy Sources:

Comments:

Central Heating System – Energy Source: Gas

Brand Name: Lennox

This component appears to be performing adequately at the time of this inspection. It is achieving an operation, function, or configuration consistent with accepted industry practices for its age.



I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I NI NP D

☒ ☐ ☐ ☒

B. Cooling Equipment

Type of Systems:

Comments:

Central Cooling System

Today's Temperature Differential (Delta-T): Unable to check Delta-T due to outdoor temperature.

Approximate System Age: **2019**

Approximate System SEER: **14**

Approximate System Size: **4 ton**

Brand Name: **Lennox**

Freon Type: **R410A**

- Air leaks were detected at and around the indoor coil housing. The air leaks should be corrected for improved efficiency.

Note: The auxiliary/secondary drain pan under the coil housing should be free of all debris. The debris in the pan could clog the drain line and cause water to leak to the interior of the house.

Note: The temperature differential of the cooling system could not be accurately checked due to the outside ambient temperature being below 60 Degrees. If any concerns exist about the system achieving a proper differential or the future operation of the cooling equipment, then it is recommended that a Qualified HVAC Technician further inspect and give an evaluation on the operation of the equipment and any further concerns that may exist with this equipment.




I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---

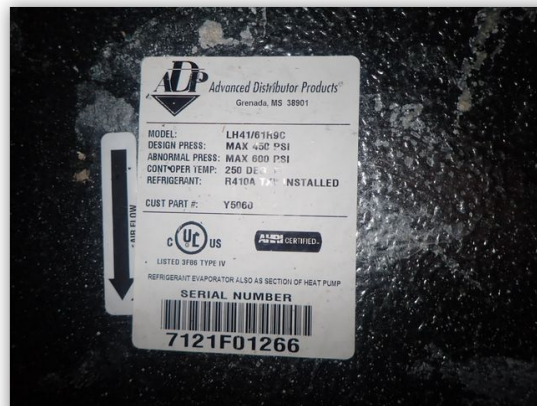

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---



Notice: Temperature differential readings (Delta-T) are an accepted industry standard of practice for testing the proper operation of the cooling system. Our company policy normal acceptable range is considered approximately **between 15 to 20 degrees °F** total difference (Delta-T) measured between the return air and supply air within close proximity of the related coils of the system being evaluated. Conditions such as but not limited to; excessive humidity, high or low outdoor temperatures or restricted airflow may indicate abnormal operation even through the equipment is functioning basically as designed and occasionally may indicate normal operation in spite of an equipment malfunction. *The inspector will not be able to anticipate future events, conditions or changes in performance of any component or system due to changes in use or occupancy. The inspector makes no guarantee or warranty, express or implied, as to future performance of any item, system or component.*

☒ ☐ ☐ ☐

C. Duct Systems, Chases, and Vents

Comments:

All components were found to be performing and in satisfactory condition on the day of the inspection.



I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---

IV. PLUMBING SYSTEMS

☒ ☐ ☐ ☒

A. Plumbing Supply, Distribution Systems and Fixtures

Location of water meter: Within 5-feet of Front Curb

Location of main water supply valve: Within 3-feet of north exterior wall.

Static water pressure reading: 50 to 60 psi

Type of supply piping material: CPVC

Comments:

Water Supply System

All components were found to be performing and in satisfactory condition on the day of the inspection.

Note: The exterior water hose bibb(s) (faucet) and exposed main water shut off adjacent to the home should be protected from physical damage and/or possible freeze.




Exterior Faucets/Fixtures

All components were found to be performing and in satisfactory condition on the day of the inspection.

Laundry Connections

All components were found to be performing and in satisfactory condition on the day of the inspection.

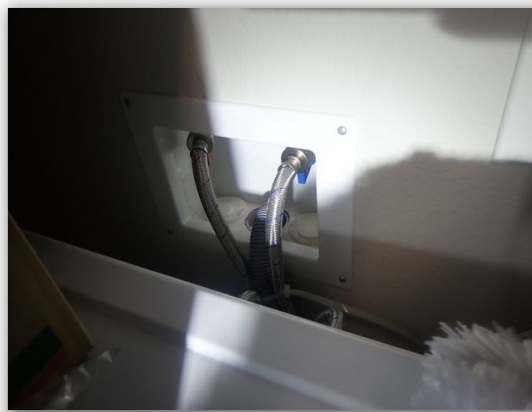

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---



Kitchen Sink

All components were found to be performing and in satisfactory condition on the day of the inspection.



Gameroom Bathroom

All components were found to be performing and in satisfactory condition on the day of the inspection.

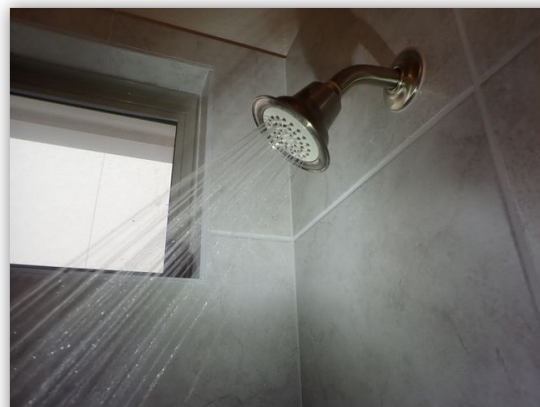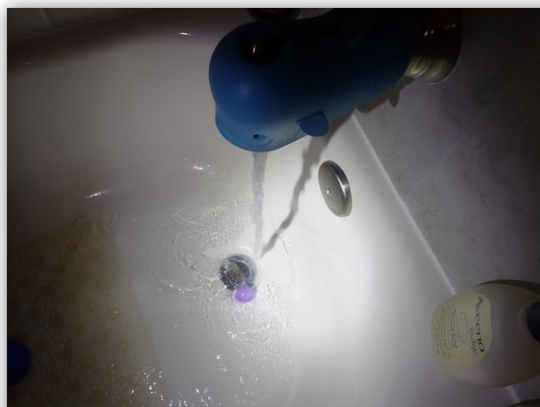

I=Inspected

NI=Not Inspected

NP=Not Present


D=Deficient

I	NI	NP	D
---	----	----	---

Primary Bathroom


Shower

- The shower spout is leaking at the neck connection.

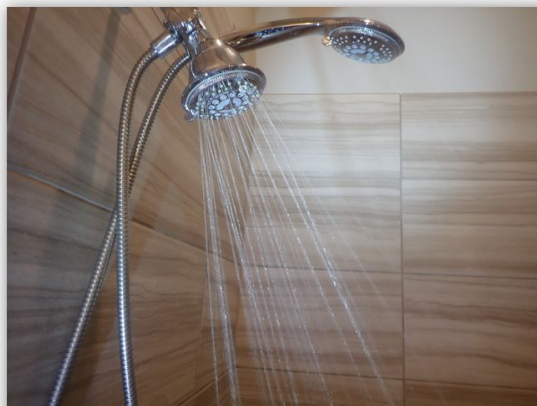

Guest Bathroom

All components were found to be performing and in satisfactory condition on the day of the inspection.

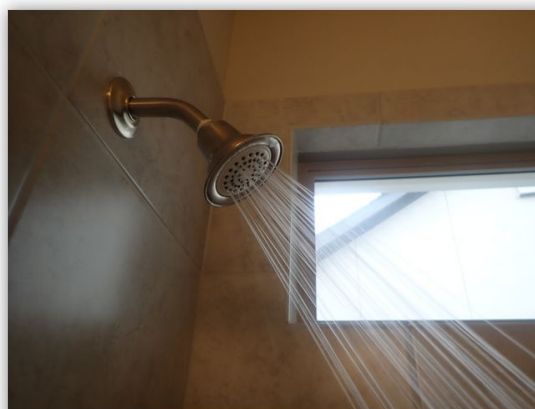

I=Inspected

NI=Not Inspected

NP=Not Present


D=Deficient

I	NI	NP	D
---	----	----	---



Hall Bathroom

All components were found to be performing and in satisfactory condition on the day of the inspection.

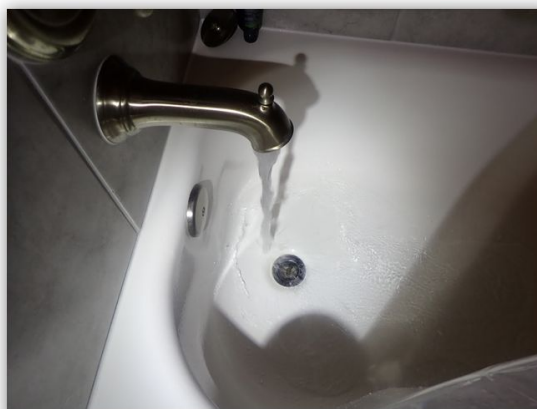

<p>Notice: The Inspector has attempted to discover and report conditions requiring further evaluation or repair. However; determining the condition of any component that is not visible and/or accessible, such as plumbing components that are buried, beneath the foundation, located within construction voids or otherwise concealed, and reporting any deficiency that does not appear or become evident during our</p>
--

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---

<p>limited cursory and visual survey is outside the scope of this inspection. <i>The inspector will not be able to anticipate future events, conditions or changes in performance of any component or system due to changes in use or occupancy. The inspector makes no guarantee or warranty, express or implied, as to future performance of any item, system or component.</i></p>
--

☒ ☐ ☐ ☐

B. Drains, Wastes, and Vents

Type of drain piping material: PVC

Comments:

All components were found to be performing and in satisfactory condition on the day of the inspection.



<p>Notice: Reporting the condition of drains, wastes and vent piping that is not completely visible and/or accessible or; reporting any defect or deficiency that requires extended use of the system to develop or does not become evident during our limited cursory and visual survey is outside the scope of the inspection. This is a limited cursory and visual survey of the accessible general conditions and circumstances present at the time of this inspection. Opinions are based on general observations made without the use of specialized tools or procedures. Therefore, the opinions expressed are one of apparent conditions and not of absolute fact and are only good for the date and time of this inspection. <i>The inspector will not be able to anticipate future events, conditions or changes in performance of any component or system due to changes in use or occupancy. The inspector makes no guarantee or warranty, express or implied, as to future performance of any item, system or component.</i></p>

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---

☒ ☐ ☐ ☒

C. Water Heating Equipment

Energy Sources:

Capacity:

Comments:

Water Heater x2 – *Energy Source: Gas*

Location: Attic

Approximate Capacity: 40 Gallons

Approximate Age: 2019

Brand Name: Bradford White

- The roof level flue storm collar needs to be properly sealed to help prevent water intrusion into the structure.





I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I NI NP D

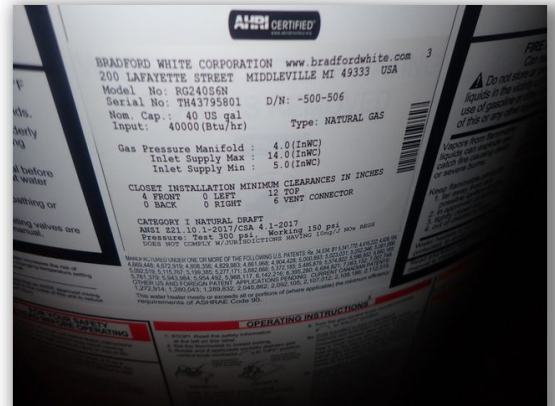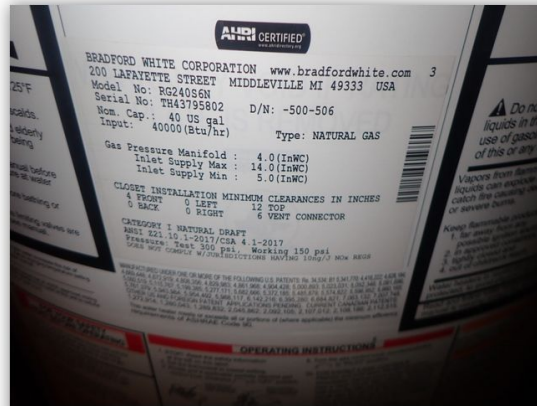

☐ ☒ ☒ ☐

D. Hydro-Massage Therapy Equipment

Comments:

☒ ☐ ☐ ☐

E. Gas Distribution Systems and Gas Appliances

Location of gas meter: Within 3-feet of south exterior wall.

Type of gas distribution piping material: Black Steel Pipe, Flexible Appliance Connector

Comments:

This component appears to be performing adequately at the time of this inspection.

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---



Notice: The Inspector will use a combustible gas leak detector on accessible gas lines, joints, unions and connectors and report visible deficiencies found at the time and date of the inspection. The inspector inspects the gas lines from the point they enter the structure and will complete the inspection without digging, damaging property, permanent construction or building finish. When performing the inspection, the inspector will keep in consideration the age of the system and normal wear and tear from ordinary use when rendering opinions.

The inspector is not required to and will not inspect sacrificial anode bonding or for its existence. The Inspector is not licensed to and will not perform a pressure test on the gas line system. The Inspector cannot detect gas leaks below the finished grade (underground), construction voids, between the walls or behind fireplace hearths. Propane tanks will not be inspected. If any further concerns exist about possible gas line failure and/or deficiencies or code compliance, we recommend the buyer have the gas system further evaluated by the local controlling gas supplier and/or a qualified licensed master plumber prior to the expiration of any time limitations such as option or warranty periods.

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---

V. APPLIANCES

☒ ☐ ☐ ☐

A. Dishwashers

Comments:

Brand Name: General Electric – GE

This component appears to be performing adequately at the time of this inspection.



☒ ☐ ☐ ☐

B. Food Waste Disposers

Comments:

This component appears to be performing adequately at the time of this inspection.



☒ ☐ ☐ ☐

C. Range Hood and Exhaust Systems

Comments:

This component appears to be performing adequately at the time of this inspection.

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---



☒ ☐ ☐ ☐

D. Ranges, Cooktops, and Ovens

Comments:

Cooktop Brand Name: General Electric – GE

Built-in Oven Brand Name: General Electric – GE

This component appears to be performing adequately at the time of this inspection.



☒ ☐ ☐ ☐

E. Microwave Ovens

Comments:

Brand Name: General Electric – GE

This component appears to be performing adequately at the time of this inspection.

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---



☒ ☐ ☐ ☒

F. Mechanical Exhaust Vents and Bathroom Heaters

Comments:

- The mechanical exhaust vent fan is noisy when not in use in the gameroom bathroom, primary bathroom.



☒ ☐ ☐ ☐

G. Garage Door Operators

Comments:

This component appears to be performing adequately at the time of this inspection.

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---



☒ ☐ ☐ ☐

H. Dryer Exhaust Systems

Comments:

This component appears to be performing adequately at the time of this inspection.



I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---

VI. OPTIONAL SYSTEMS

☒ ☐ ☐ ☒

A. Landscape Irrigation (Sprinkler) Systems

Comments:


When the system is operational, all of the sprinkler system associated components are inspected and operated in the manual settings only.

Note: Some municipalities now require moisture (rain/freeze) sensors to be installed on all new installation and existing sprinkler systems. Our company does not maintain a list of municipalities that require the installation of a moisture sensor. Please check with your municipality for moisture sensor requirements. Sprinkler system equipped with a moisture (rain/freeze) sensor ☒ Yes or ☐ No.

Total Number of Zones Wired: 8

Sprinkler System and Associated Components

- The exterior moisture (rain/freeze) sensor device does not appear to be properly installed and should be corrected for proper sensor operation.
- One or more of the sprinkler heads need to be adjusted and/or straightened so to disperse water properly in station(s); **7**.
- One or more of the handles were observed to be damaged/rusted at the anti-siphon device. This may prevent you from being able to shutoff the water to the system or test the device.

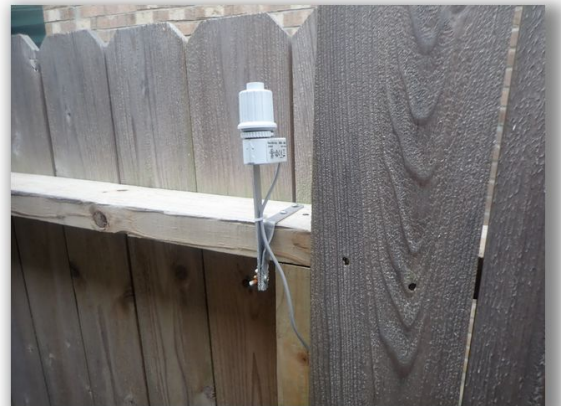

I=Inspected	NI=Not Inspected	NP=Not Present	D=Deficient
I	NI	NP	D



I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---



☒ ☐ ☐ ☐

B. Thermal Imaging / Infrared

Comments:

All components were found to be performing and in satisfactory condition on the day of the inspection.




I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I NI NP D

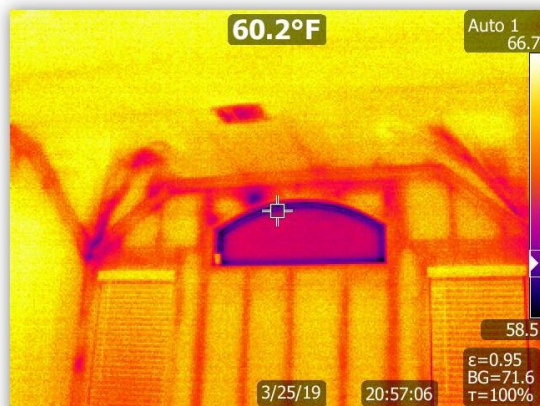

INSPECTION AGREEMENT
PLEASE READ THIS AGREEMENT CAREFULLY BEFORE SIGNING

This Inspection Agreement (herein after known as the Agreement) is entered into on this day, 01/10/2022, between Sample Report (herein known as the Client) and A-Action (herein known as the Inspector) for the purpose of performing a general property condition inspection concerning 1234 Sample Road (herein known as the property).

I. SCOPE OF SERVICES

- A. A real estate inspection is a non-technically exhaustive, limited visual survey and basic performance evaluation of the systems and components of a building using normal controls and does not require the use of specialized equipment or procedures. The purpose of the inspection is to provide the Client with information regarding the general condition of the Property at the time of inspection.
- B. In exchange for the inspection fee (\$0.00) paid by the Client, the Inspector agrees to provide the Client with an Inspection Report setting out the Inspector's professional opinions concerning the condition of the Property further described in the report. The inspection will be performed in accordance with the Standards of Practice promulgated by the Texas Real Estate Commission. Inspector will attempt to identify major defects and problems with the Property. However, Client acknowledges that the Inspection Report may not identify all defects or problems.
- C. The inspection is limited to those items which are easily accessible, seen, viewed or capable of being approached, entered and/or operated by the Inspector at the time of the inspection as set out in the Inspection Report. The Inspector will not climb over obstacles, move furnishings or large, heavy, or fragile objects, remove walls, floors, wall coverings, floor coverings and other obstructions in order to inspect concealed items. The inspector will not turn on decommissioned equipment, systems, utility services. Systems, components and conditions which are not specifically addressed in the Inspection Report are excluded.
- D. The Inspection Report may indicate one of the following opinions of the Inspector regarding a particular item:
 - 1. The item is performing its intended function, achieving an operation, function or configuration relative to accepted industry standard practices with consideration of age and normal wear and tear from ordinary use at the time of the inspection;
 - 2. The item is in need of replacement, maintenance or repair; or
 - 3. Further evaluation by an expert is recommended.

II. INSPECTION REPORT

- A. The Inspection Report provided by the Inspector will contain the Inspector's professional, good-faith opinions concerning the need for repair or replacement of certain observable items. All statements in the report are the Inspector's opinions and should not be construed as statements of fact or factual representations concerning the Property. **By signing this Agreement, the Client understands that the services provided by the Inspector fall within the Professional Services Exemption of the Texas Deceptive Trade Practices Act ("DTPA") and agrees that no cause of action exists under the DTPA related to the services provided.**
- B. **Unless specifically stated, the report WILL NOT INCLUDE and should not be read to indicate OPINIONS AS TO:**
 - 1. the presence, absence, or risk of environmental conditions such as asbestos, lead-based paint, **MOLD**, mildew, corrosive or contaminated drywall "Chinese Drywall" or any other environmental hazard, environmental pathogen, carcinogen, toxin, mycotoxin, pollutant, fungal presence or activity, poison, presence of toxic or hazardous waste or substances;
 - 2. presence or absence of pests, termites, or other wood-destroying insects or organisms;
 - 3. **COMPLIANCE WITH compliance with any ordinances, statutes or restrictions, CODE, listing, testing or protocol authority, utility sources, property association guidelines or requirements, manufacturer or regulatory requirements;**
 - 4. insurability, efficiency warrantability, suitability, adequacy, compatibility, capacity, durability, quality reliability, marketability, operating costs, recalls, counterfeit products, product lawsuits, age, energy efficiency; or
 - 5. anticipate future life or future events or changes in performance of any item inspected.
- C. The Inspection Report is not a substitute for disclosures by sellers and real estate agents. Said disclosure statements should be carefully investigated for any material facts that may influence or effect the desirability and/or market value of the Property.
- D. As noted above, the Inspection Report may state that further evaluation of certain items is needed by an expert in the field of the item inspected. By signing this Agreement, Client acknowledges that qualified experts may be needed to further evaluate such items as structural systems, foundations, grading, drainage, roofing, plumbing, electrical systems, HVAC, appliances, sprinkler systems pool system and components, fire/smoke detection systems, septic systems and other observable items as noted in the report. Any such follow-up should take place prior to the expiration of any time limitations such as option or warranty periods.

III. DISCLAIMER OF WARRANTIES

The inspector makes no guarantee or warranty, express or implied, as to any of the following:

1. That all defects have been found or that the Inspector will pay for repair of undisclosed defects;
2. That any of the items inspected are designed or constructed in a good and workmanlike manner;
3. That any of the items inspected will continue to perform in the future as they are performing at time of the inspection; and
4. That any of the items inspected are merchantable or fit for any particular purpose.

IV. LIMITATION OF LIABILITY

BY SIGNING THIS AGREEMENT, CLIENT ACKNOWLEDGES THAT THE INSPECTION FEE PAID TO THE INSPECTOR IS NOMINAL GIVEN THE RISK OF LIABILITY ASSOCIATED WITH PERFORMING HOME INSPECTIONS IF LIABILITY COULD NOT BE LIMITED. CLIENT ACKNOWLEDGES THAT WITHOUT THE ABILITY TO LIMIT LIABILITY, THE INSPECTOR WOULD BE FORCED TO CHARGE CLIENT MUCH MORE THAN THE INSPECTION FEE FOR THE INSPECTOR'S SERVICES. CLIENT ACKNOWLEDGES BEING GIVEN THE OPPORTUNITY TO HAVE THIS AGREEMENT REVIEWED BY COUNSEL OF HIS OR HER OWN CHOOSING AND FURTHER ACKNOWLEDGES THE OPPORTUNITY OF HIRING A DIFFERENT INSPECTOR TO PERFORM THE INSPECTION. BY SIGNING THIS AGREEMENT, CLIENT AGREES TO LIABILITY BEING LIMITED TO THE AMOUNT OF THE INSPECTION FEE PAID BY THE CLIENT. \$0.00

V. DISPUTE RESOLUTION

In the event a dispute arises regarding an inspection that has been performed under this agreement, the Client agrees to notify the Inspector within ten (10) days of the date the Client discovers the basis for the dispute so as to give the Inspector a reasonable opportunity to reinspect the property. Client agrees to allow reinspection before any corrective action is taken. Client agrees not to disturb or repair or have repaired anything which might constitute evidence relating to a complaint against the Inspector. Client further agrees that the Inspector can either conduct the reinspection himself or can employ others (at Inspector's expense) to reinspect the property, or both. In the event a dispute cannot be resolved by the Client and the Inspector, the parties agree that any dispute or controversy shall be resolved by mandatory and binding arbitration administered by the American Arbitration Association ("AAA") pursuant to Chapter 171 of the Texas Civil Practice & Remedies Code and in accordance with this arbitration agreement and the commercial arbitration rules of the AAA.

VI. ATTORNEY'S FEES

The Inspector and the Client agree that in the event any dispute or controversy arises as a result of this Agreement, and the services provided hereunder, the prevailing party in that dispute shall be entitled to recover all of the prevailing party's reasonable and necessary attorneys' fees and costs incurred by that party.

VII. EXCLUSIVITY

The Inspection Report is to be prepared exclusively for the Client and is not transferable to anyone in any form. Client gives permission for the Inspector to discuss report findings with real estate agents, specialists, or repair persons for the sake of clarification. A copy of the Inspection Report may be released to the buyers Real Estate Agent.

BY MY SIGNATURE BELOW, I ACKNOWLEDGE THAT I HAVE READ THIS CONTRACT AND THAT THE INSPECTOR DID NOT COERCE, PRESSURE OR RUSH ME TO EXECUTE THIS CONTRACT WITHOUT OPPORTUNITY TO FULLY REVIEW THE CONTRACT AND IF NECESSARY HAVE THE CONTRACT REVIEWED BY AN ATTORNEY; THAT INSPECTOR AGREED TO RESCHEDULE THE INSPECTION IN THE EVENT I REQUIRED ADDITIONAL TIME TO REVIEW THE CONTRACT; THAT I UNDERSTAND THE TERMS AND CONDITIONS AND THAT I AGREE TO BE BOUND BY THESE TERMS AND CONDITIONS. IF CLIENT IS MARRIED, CLIENT REPRESENTS THAT THIS OBLIGATION IS A FAMILY OBLIGATION INCURRED IN THE INTEREST OF THE FAMILY.

Client Signature: _____

Date: 01/10/2022

Inspector: Joshua Gibson